

Technical Service Bulletin



Dodge


Dodge Cars

Of Interest ☐ General Manager ☐ Sales Manager ☐ Service Manager ☐ Parts Manager ☐ Service Technicians

A new piston will be incorporated into production on the 440 C.I.D. standard engine late in 1971 production. This piston is lighter than the early piston so requires a new crankshaft. Severe engine vibration will result if the early crankshaft or piston is used in these engines.

The engines will be identified with the letter "C" on the information pad on the top, adjacent to the left bank and tappet rail as follows:

Example: Engine Serial Pad

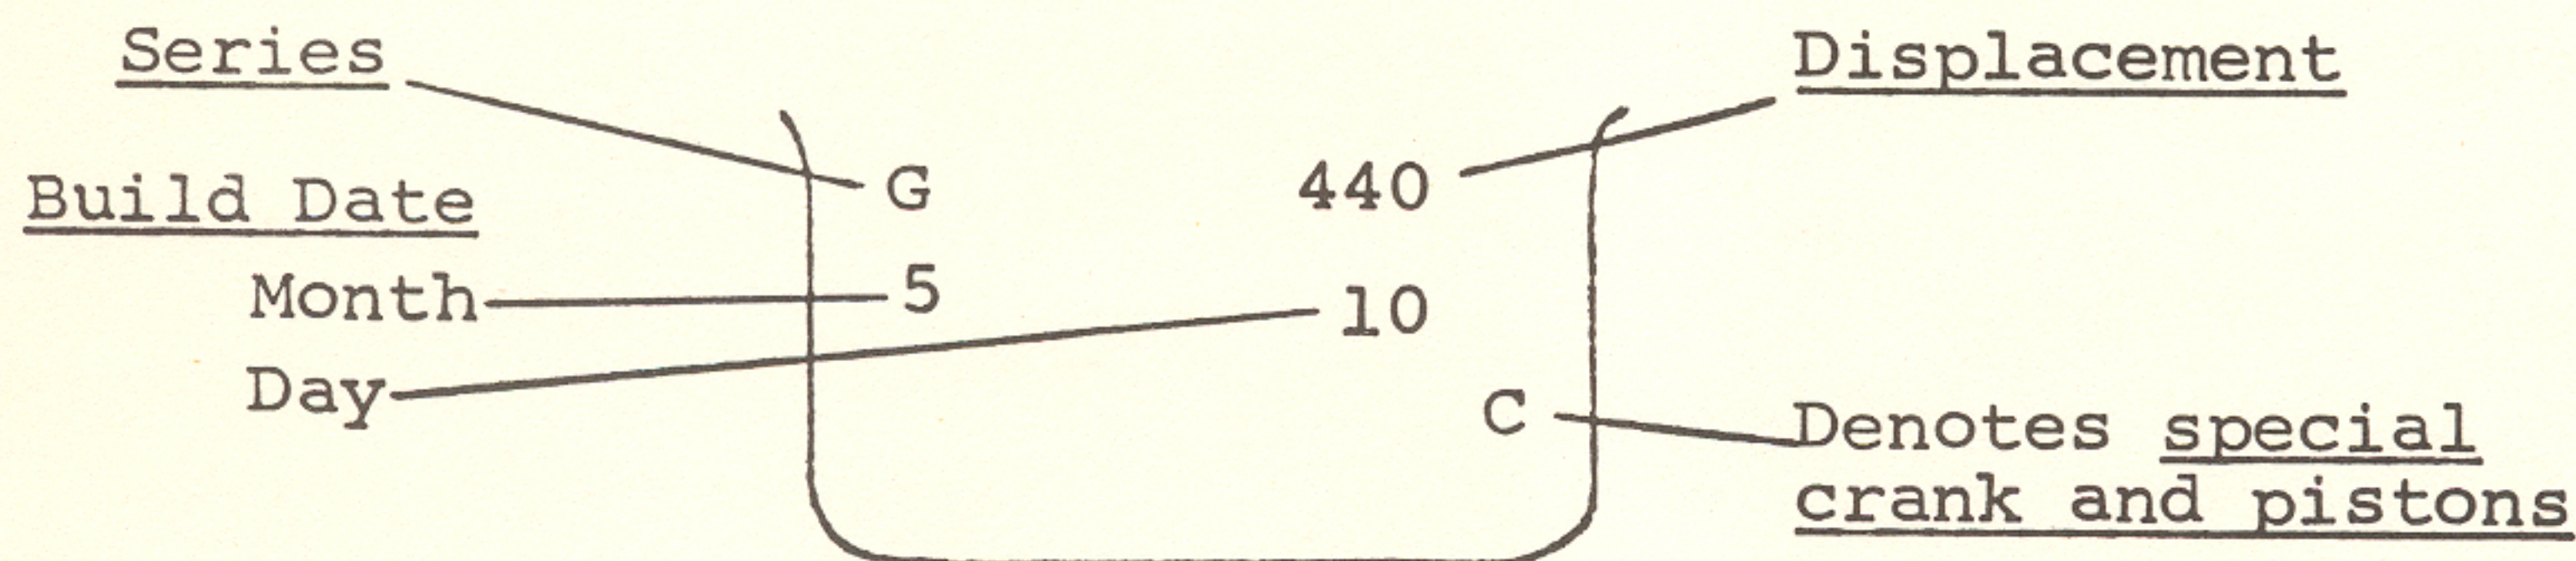

The new piston and crankshaft are serviced as shown below:

<u>Per Car</u>	<u>Part No.</u>	<u>Part Description</u>
1	3671242	Crankshaft
8	3579047	Piston, Standard
8	3579049	Piston, .020" OS

POLICY: INFORMATION ONLY

J. D. MORTON
Manager - Technical Services
U. S. AUTOMOTIVE SALES & SERVICE

June 23, 1971

No. D71-9-8

ENGINE

Piston Change

MODELS: 1971
Equipped With
440 C.I.D.
Std. Engine

P-1741-C

(THIS BULLETIN IS SUPPLIED AS TECHNICAL INFORMATION ONLY AND IS NOT AN AUTHORIZATION FOR REPAIRS)
REPRINT OF THIS MATERIAL NOT AUTHORIZED UNLESS APPROVED.



COLT/CHALLENGER/CHARGER/CORONET/DART/MONACO/POLARA